

KHX3200UL/256

256MB 32M x 64-Bit PC3200

CL2 184-Pin DIMM

DESCRIPTION:


This document describes Kingston's 32M x 64-bit (256MB) DDR400 SDRAM (Synchronous DRAM) CL2 memory module, based on eight 32M x 8-bit DDR TSOP components. This module has been tested to run at DDR 400MHz at low latency timing of 2-2-2-5 at 2.7V. This 184-pin DIMM uses gold contact fingers and requires +2.6V. The electrical and mechanical specifications are as follows:


FEATURES:

- ✓ Power supply : Vdd: 2.6V $\pm$ 0.2V, Vddq: 2.6V $\pm$ 0.2V
- ✓ Double-data-rate architecture; two data transfers per clock cycle
- ✓ Bidirectional data strobe(DQS)
- ✓ Differential clock inputs(CK and CK)
- ✓ DLL aligns DQ and DQS transition with CK transition
- ✓ Programmable Read latency 2 (clock)
- ✓ Programmable Burst length (2, 4, 8)
- ✓ Programmable Burst type (sequential & interleave)
- ✓ Timing Reference: 2-2-2-5 at +2.7V
- ✓ Edge aligned data output, center aligned data input
- ✓ Auto & Self refresh, 7.8 μ s refresh interval (8K/64ms refresh)
- ✓ Serial presence detect with EEPROM
- ✓ High Performance Heat Spreader
- ✓ PCB : Height 1.250" (34.75mm), double sided component

PERFORMANCE:

- | | |
|---------------------------------|--------------------------------|
| ✓ Clock Cycle Time (tCK) | 5ns (min.) / 10ns (max.) |
| ✓ Row Cycle Time (tRC) | 55ns (min.) |
| ✓ Refresh Row Cycle Time (tRFC) | 65ns (min.) |
| ✓ Row Active Time (tRAS) | 40ns (min.) / 100,000ns (max.) |
| ✓ Power | 2.268 W (operating) |
| ✓ UL Rating | 94 V - 0 |
| ✓ Operating Temperature | 0° C to 70° C |
| ✓ Storage Temperature | -55° C to +150° C |

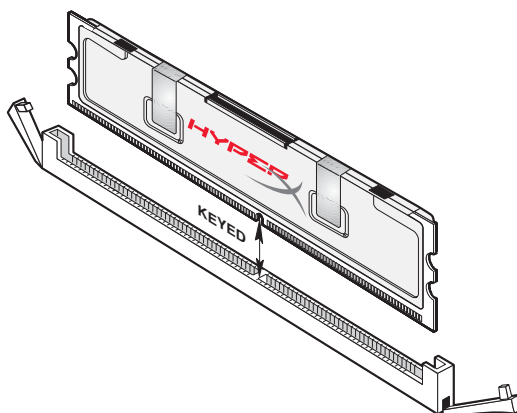

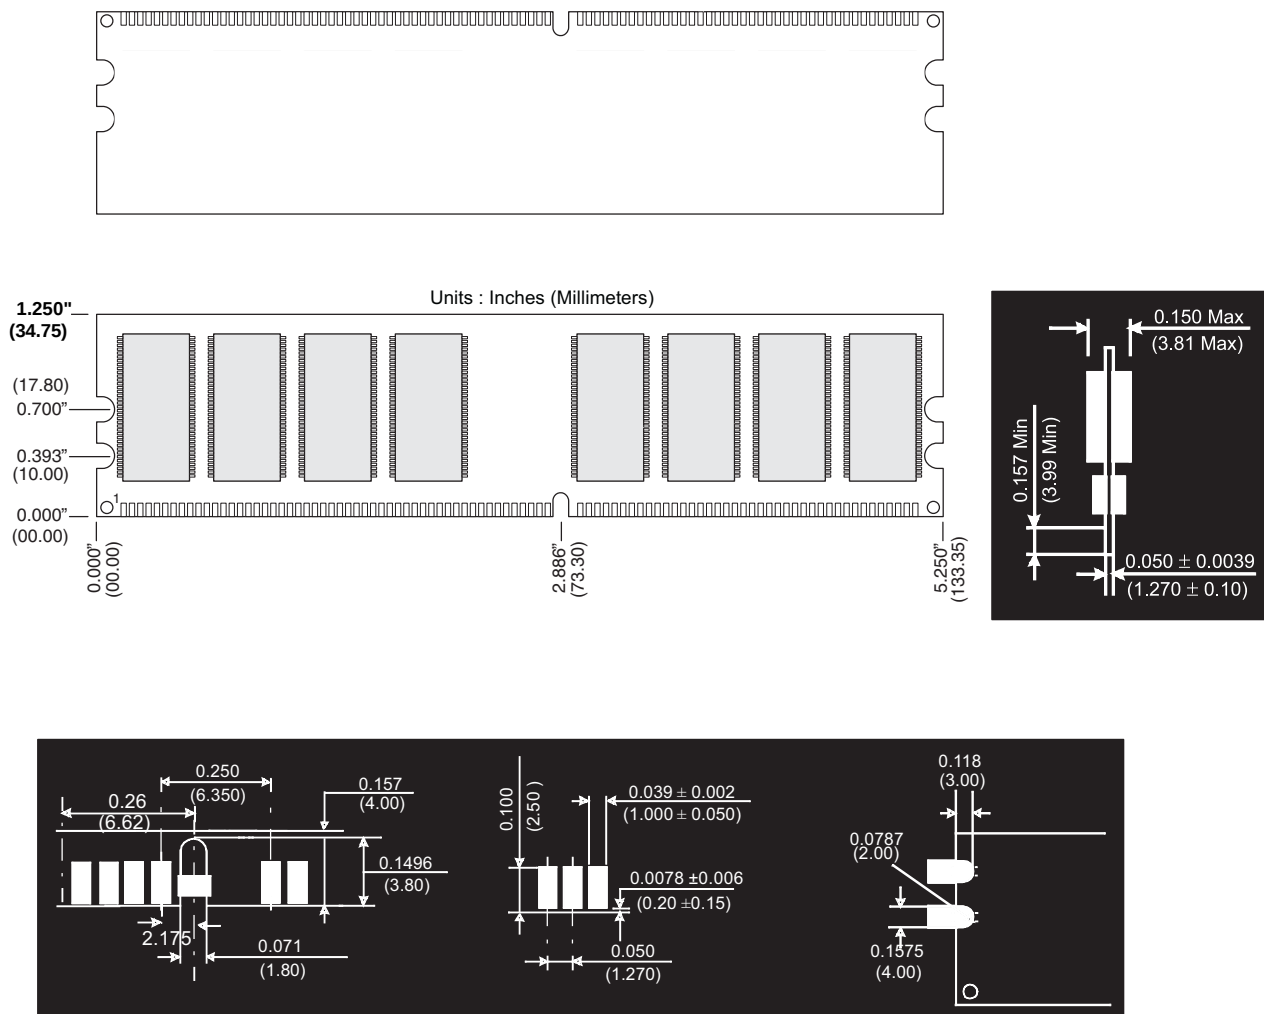MODULE DIMENSIONS:

For more information, go to www.kingston.com

All Kingston products are tested to meet our published specifications. Some motherboards or system configurations may not operate at the published HyperX memory speeds and timing settings. Kingston does not recommend that any user attempt to run their computers faster than the published speed. Overclocking or modifying your system timing may result in damage to computer components.