

KHX8500AD2K2/4G

4GB (2GB 256M x 64-Bit x 2 pcs.)
PC2-8500 CL7 240-Pin DIMM Kit

DESCRIPTION:


Kingston's KHX8500AD2K2/4G is a kit of two 256M x 64-bit 2GB (2048MB) DDR2-1066 CL7 SDRAM (Synchronous DRAM) memory modules, based on sixteen 128M x 8-bit DDR2 FBGA components per module. Total kit capacity is 4GB (4096MB). Each module pair has been tested to run at DDR2- 1066MHz at a latency timing of 7-7-7-20 at +1.85V to +2.0V. The SPD is programmed to JEDEC standard latency 800Mhz timing of 6-6-6-18 at +1.8V. Each 240-pin DIMM uses gold contact fingers and requires +1.8V. The electrical and mechanical specifications are as follows:


FEATURES:

- ✓ Power supply : Vdd: 1.8V $\pm$ 0.1V, Vddq: 1.8V $\pm$ 0.1V
- ✓ Double-data-rate architecture; two data transfers per clock cycle
- ✓ Bidirectional data strobe(DQS)
- ✓ Differential clock inputs(CK and CK)
- ✓ DLL aligns DQ and DQS transition with CK transition
- ✓ Programmable Read latency 6, 5, 4 (clock)
- ✓ Burst Length: 4, 8 (Interleave/nibble sequential)
- ✓ Programmable Burst type (sequential & interleave)
- ✓ Timing Reference: 6-6-6-18 at +1.8V / 7-7-7-20 at +1.85 to +2.0V
- ✓ Edge aligned data output, center aligned data input
- ✓ Auto & Self refresh, 7.8us refresh interval (8K/64ms refresh)
- ✓ Serial presence detect with EEPROM
- ✓ High Performance Heat Spreader
- ✓ PCB : Height 1.180" (30.00mm), double sided component

PERFORMANCE:

- | | |
|---|--------------------------------|
| ✓ Clock Cycle Time (tCK) CL=5 | 2.5ns (min.) / 8ns (max.) |
| ✓ Row Cycle Time (tRC) | 60ns (min.) |
| ✓ Refresh to Active/Refresh Command Time (tRFC) | 127.5ns |
| ✓ Row Active Time (tRAS) | 45ns (min.) / 70,000ns (max.) |
| ✓ Single Power Supply of | +1.8V (+/- .1V) |
| ✓ Power | 1.584 W (operating per module) |
| ✓ UL Rating | 94 V - 0 |
| ✓ Operating Temperature | 0° C to 55° C |
| ✓ Storage Temperature | -55° C to +125° C |

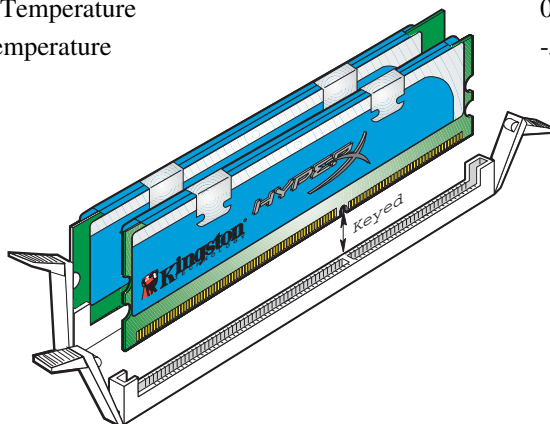

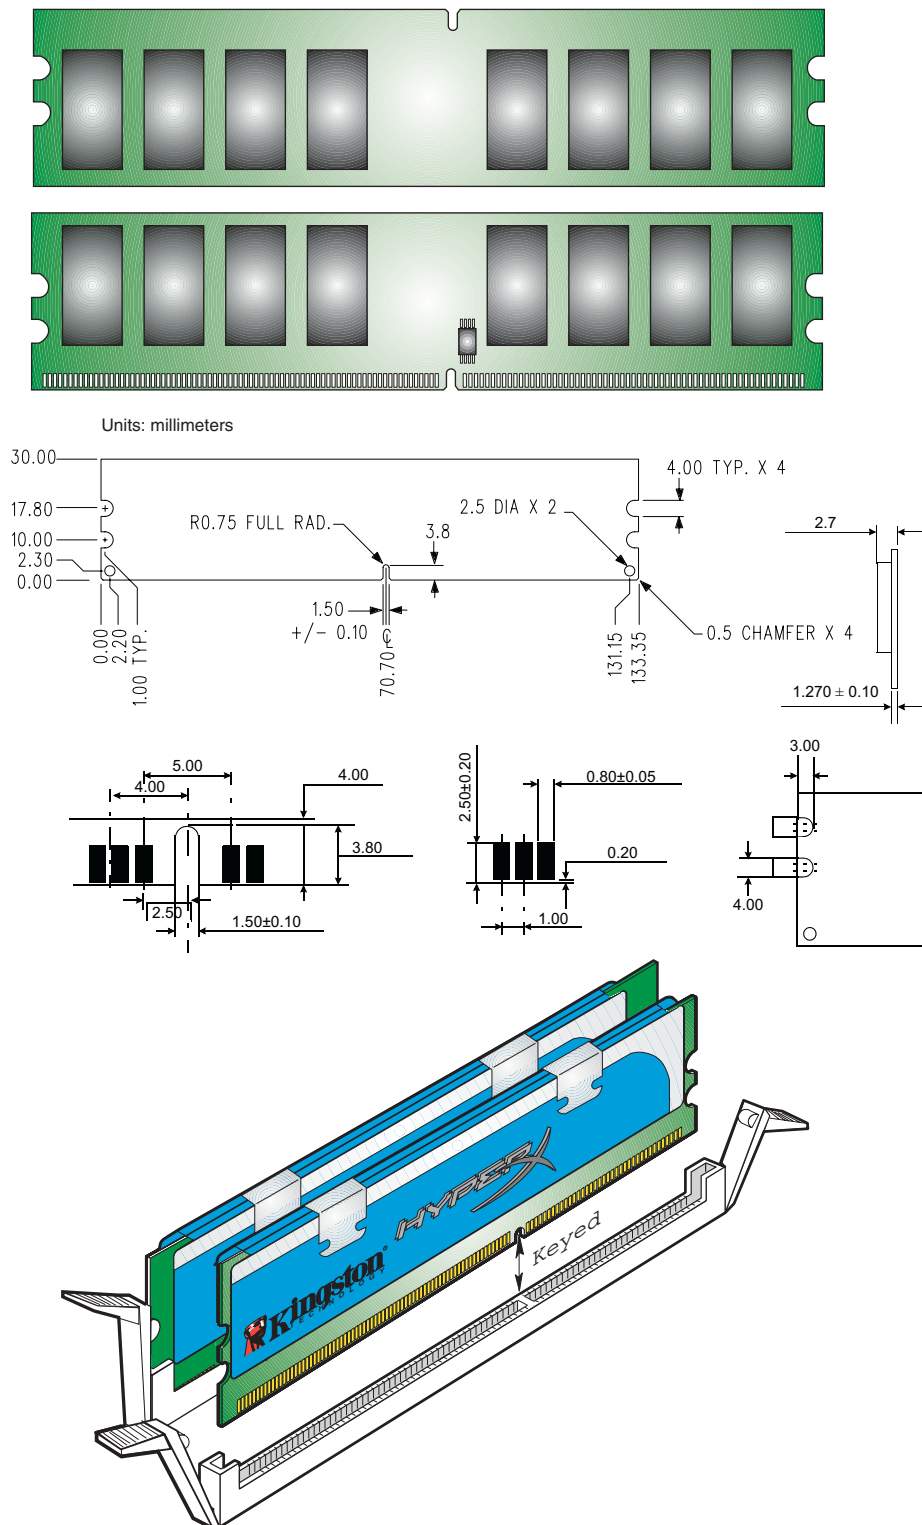MODULE DIMENSIONS:

For more information, go to www.kingston.com

All Kingston products are tested to meet our published specifications. Some motherboards or system configurations may not operate at the published HyperX memory speeds and timing settings. Kingston does not recommend that any user attempt to run their computers faster than the published speed. Overclocking or modifying your system timing may result in damage to computer components.